

DESCRIPTION

The SI239 is loop powered isolator used to measure DC voltages and process currents plus a range of optional inputs. Input/output isolation of 2kV rms is achieved by transformer coupling of power supply and signal. The SI239 accepts a wide range of dc voltage and current input signals as well a supporting reverse and direct action mode at no extra cost. Standard output is 4-20mA with a minimum supply voltage of 8V. This enables the SI239 to be used in 12V battery supply systems or in automotive applications. Other factory set output configurations are 10 - 50mA loop powered and 0 - 10mA, 0 - 20mA or voltage output in 3-wire connection. Double surge protection is standard with all Series 200 loop powered transmitters to prevent failure due to spikes induced by DC switched inductive loads. Final calibration is trimmed using the front accessible zero and span 15-turn trim adjustments. A front mounted L.E.D. and a test socket verify module function and assist in calibration checks without disconnection of output wires.



General Specifications


- Size: 23.5W x 71.5H x 109D (mm).
- Mounting: Clip for 35mm DIN-Rail.
- Housing material: ABS.
- Connection: Screw terminals.
- Weight: 0.120 kg.
- Protection class: IP40.
- Cal. accuracy: <0.2%.
- Linearity: <0.2%.
- Long term drift: <0.10%.
- Ambient operating range: -10...+65°C.
- Temperature drift error: 0.02% per °C.
- Supply voltage: 8 - 40V continuous (50V 30 seconds).

Load for 4 - 20mA output:
$$RL_{max} = \frac{SupplyVoltage - 8V}{0.02A} \Omega$$

- Load change effect: 0.1% up to RL max.
- Response time: 500ms. (custom filtering on request).
- Input impedance: >500kΩ up to 10MΩ voltage inputs.
- Overload continuous: 500% of rated input.
- Front Zero adjust: +20/ -10% typical.
- Front Span adjust: ±25% typical.
- Internal Offset Adjust: ±50%.
- Noise immunity: 130dB CMRR.
- Input/output isolation: >2kV rms.

Electromagnetic compatibility: Complies with AS/NZS 4251.1 (EN 50081.1)

Block Diagram

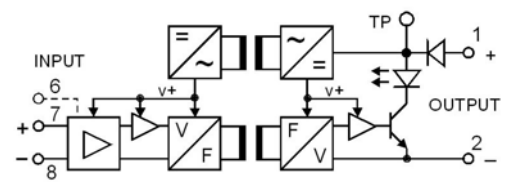

For link selectable process signal inputs refer to SI231.

For input / output combinations refer to TYPE NO. DESIGNATION overleaf.

TYPE NO. DESIGNATION

Power Supply:

| | | | | | | | | |
|---|---|--------|---|---|--------|---|---|--------|
| <ul style="list-style-type: none"> 1 = 4 - 20mA. 2 = 10 - 50mA. | } | 2-Wire | <ul style="list-style-type: none"> *) 3 = 0 - 1mA. *) 4 = 0 - 10mA. *) 5 = 0 - 20mA. | } | 3-Wire | <ul style="list-style-type: none"> *) 6 = 0 - 1V. *) 7 = 0 - 5 V, min supply 10.5Vdc. *) 8 = 0 - 10V, min supply 15.5Vdc. *) 9 = Other (Specify). | } | 3-Wire |
|---|---|--------|---|---|--------|---|---|--------|

Input:

| | |
|--|---|
| <ul style="list-style-type: none"> 01 = 0 - 100mV. 02 = 0 - 200mV. 03 = 0 - 500mV. 04 = 0 - 1V. 05 = 0 - 2V. 06 = 0 - 5V. 07 = 0 - 10V. 08 = 0 - 100V. 09 = 1 - 5V. | <ul style="list-style-type: none"> 11 = 0 - 1mA. 12 = 0 - 5mA. 13 = 0 - 10mA. 14 = 0 - 20mA. 15 = 0 - 50mA. 16 = 4 - 20mA. 17 = 10 - 50mA. |
|--|---|

*) 19 = Other. (Specify 100Vdc or 100mA max).

- **Input Opt:** (Inputs continued)
- *) 21 = DC voltage up to 2000Vdc.
- *) 22 = DC millivolt, <100mVdc.
- *) 23 = DC voltage, bipolar 10mV to $\pm 2kV$.
- *) 24 = DC current input 10A max.
- *) 32 = True rms., other than sine wave
- *) 43 = Watermark Soil Moisture SMS009.
- *) 61 = Adder, 2 inputs 4 - 20mA floating.
- *) 62 = Subtractor, 2 inputs 4 - 20mA floating.
- *) 64 = MIN selector, 2 inputs 4-20mA signal.
- *) 65 = MAX selector, 2 inputs 4-20mA signal.
- *) 66 = Triple input adder (3x 4-20mA floating).
- *) 67 = Quad input adder (4x 4-20mA floating).
- *) 99 = Other.

- Specify calibration details for all optional inputs.

Action:

| | |
|-------------|--------------|
| 1 = Direct. | 2 = Reverse. |
|-------------|--------------|


Options:

| | |
|--------------------------------------|----------------------------------|
| 0 = None. | *) 2 = Customised response time. |
| *) 1 = Output ramp (ext. capacitor). | *) 9 = Other (Specify). |


*) = Price Extra.

Front Control Explanation

- 1) Test socket - output signal access with reference to terminal (1) loop integrity is maintained when digital multimeter Rin < 30 Ω is used.
- 2) Loop indicator - dim at 4mA, bright at 20mA.
- 3) SPAN (full scale) adjust 15 turn.
- 4) ZERO (start scale) adjust 15 turn.

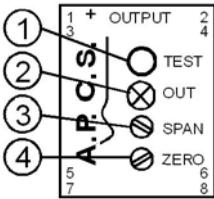


Wiring Example

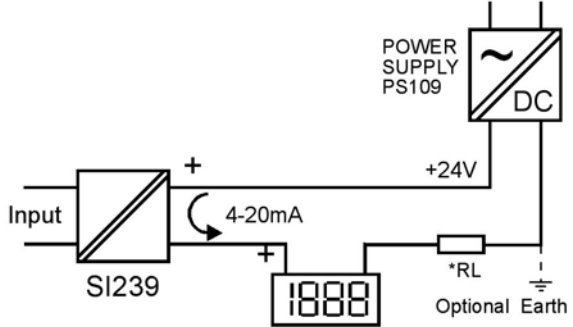

* RL is input load of a process instrument.

Connection Diagrams

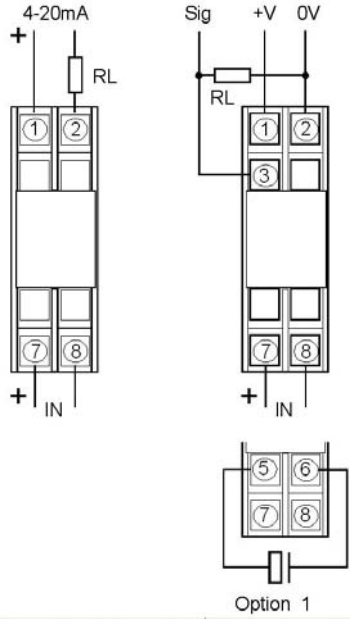

In the interest of development and improvement, A.P.C.S. Pty. Ltd. reserve the right to amend, without notice, details contained in this publication. A.P.C.S. PTY. LTD. will accept no legal liability for any errors, omissions or amendments.